Honeywell

Interactive Catalog Replaces Catalog Pages

Honeywell Sensing and Control has replaced the PDF product catalog with the new Interactive Catalog. The Interactive Catalog is a power search tool that makes it easier to find product information. It includes more installation, application, and technical information than ever before.



Click this icon to try the new Interactive Catalog.

Sensing and Control Honeywell Inc. 11 West Spring Street Freeport, Illinois 61032



Solid State Sensors

Closed Loop Current Sensors



FEATURES

- Current sensing up to 1200 amps
- Measures AC, DC and impulse currents
- Lowest cost/performance ratio
- Rapid response, no overshoot
- High overload capacity
- High level of electrical isolation between primary and secondary circuits
- Small size and weight

CLOSED LOOP SENSORS

Closed loop current sensors measure AC, DC and impulse currents over 0-25, 0-50, 0-100, 0-600 and 0-1200 Amp ranges. The CSN Series is based on the principles of the Hall effect and the null balance or zero magnetic flux method (feedback system). The magnetic flux in the sensor core is constantly controlled at zero. The amount of current required to balance zero flux is the measure of the primary current flowing through the conductor, multiplied by the ratio of the primary to secondary windings. This closed loop current is the output from the device and presents an image of the primary current reduced by the number of secondary turns at any time. This current can be expressed as a voltage by passing it through a resistor.

CATALOG NUMBER SYSTEM

PLEASE NOTE: This matrix is intended only to aid you in identifying sensor catalog listings. It is not all-inclusive, and must not be used to form new listings.

Example: CSNA111

CSN Closed Loop Current Sensor

Current Range (Peak/RMS nom.)

- $\mathbf{A} \pm 70 \text{ A}/50 \text{ A rms nom.}$
- **B** $\pm 100 \text{ A/}50 \text{ A rms nom.}$
- ±90 A/50 A rms nom.
- $\pm 22 \text{ A}/15 \text{ A rms nom.}$
- $\mathbf{E} \pm 36 \text{ A}/25 \text{ A rms nom.}$
- $\pm 150 \text{ A}/100 \text{ A rms nom.}$
- **J** $\pm 600 \text{ A}/300 \text{ A rms nom.}$
- **K** ±1200 A/500 A rms nom.
- L ±600 A/300 A rms nom.
- **M** $\pm 1200 \text{ A}/500 \text{ A rms nom.}$
- \mathbf{P} ±90 A/50 A rms nom.
- \mathbf{R} ±200 A/125 A rms nom.
- ±150 A/50 A rms nom.

Supply Voltage

- 1 ±15 V
- ±13 V 2
- 3 ±5 V
- 4 ±12 V to 18 V
- ±15 V to 24 V
- 6 ±12 V to 15 V

Coil Characteristics

- **1** 1:1000 turns/90 Ω @ 70°C
- **2** 1:2000 turns/160 Ω @ 70°C
- **3** 1:2000 turns/130 Ω @ 70°C
- **4** 1:1000 turns/50 Ω @ 70°C
- **5** 1:1000 turns/110 Ω @ 70°C **6** 1:1000 turns/30 Ω @ 70°C
- **7** 1:2000 turns/80 Ω @ 70°C
- **8** 1:2000 turns/25 Ω @ 70°C
- **9** 1:5000 turns/50 Ω @ 85°C

Housing Material

1 Polycarbonate/ABS blend

ဂ

Solid State Sensors

Closed Loop Current Sensors

CSNA, CSNB, CSNE SERIES ORDER GUIDE

Current Supply Catalog Range Voltage		Cha	Coil racteristics	Meas. Currents	Meas. Resist		
Listing	Amps	VDC ±5%	Turns	Resistance	Nom.	(@ I _{nom})	
CSNA111	±70	±15	1000	90Ω @ 70°C	50 mA for 50 A	40 to 130 Ω	
CSNB121	±100	±15	2000	160Ω @ 70°C	25 mA for 50 A	40 to 270 Ω	
CSNB131	±100	±15	2000	130Ω @ 70°C	25 mA for 50 A	40 to 300 Ω	
CSNE151	±5-36	±15	1000	110Ω @ 70°C	25 mA for 25 A	100 to 320 Ω	
CSNE381*	±5-36	±5V	1000	66Ω @ 70°C	25 mA for 25 A	0 to 84 Ω	
CSNH151*	±4-43	±15V	1000	110Ω @ 70°C	25 mA for 25 A	100 to 320 Ω	

NOTE: Extended temperature range and potting also available.

SPECIFICATIONS


Catalog Listing	CSNA111	CSNB121	CSNB131	CSNE151			
Offset Current @ 25°C, mA max.	±0.20	±0.10	±0.10	±0.10			
Temperature Drift, 0 to 70°C, mA	±0.35 typ. ±0.60 max.	±0.20 typ. ±0.30 max.	±0.20 typ. ±0.30 max.	±0.17 typ. ±0.60 max.			
Linearity	0.1%	0.1%	0.1%	0.2%			
Supply Voltage	±15V	±15V	±15V	±15V			
Galvanic Isolation @ 50 Hz/1 min.	2.5 kV rms			5 kV rms			
Accuracy	±0.5% of I _N (nominal	Current) at 25°C		·			
Response Time	<1 μs	<1 μs					
Bandwidth	DC to 150 kHz						
Temperature	Operating: 0 to 70°C	(32 to 150°F)	Storage: -25 to 85°C (-	I3 to 185°F)			
Primary Circuit Connection	Thru-hole	Thru-hole	Thru-hole	Invasive on 10 pins			
Secondary Circuit Connection	3 Pins	3 Pins 3 Pins 3 Pins 3 Pins					
Current Drain	10 mA (no load current) + output current (secondary current)						
"In-Out" Sense Signal	To obtain positive measuring current on O/P terminal, current must flow in direction of arrow						
Mounting	PCB, 3 pins, hole size	e 0.95 mm		PCB, 13 pins			


PRIMARY PIN CONNECTIONS FOR CSNE151

	Primary	Current	Output	Primary	
Primary Turns	Nom. I _{DN} (A)	Max. I _D (A)	Current (mA)	Resistance (m Ω)	Primary Pin Connections
1	24	36	25	0.3	5 4 3 2 1 0 0 0 0 0 In Out 6 7 8 9 10
2	12	18	24	1.1	5 4 3 2 1 In Out 6 7 8 9 10
3	8	12	24	2.5	5 4 3 2 1 In Out 6 7 8 9 10
4	6	9	24	4.4	5 4 3 2 1 In Out 6 7 8 9 10
5	5	7	25	6.3	5 4 3 2 1 In Out 6 7 8 9 10

WIRING DIAGRAMS

CSNA111/CSNB121/CSNB131






^{*} Contact the 800 number for more information.


Closed Loop Current Sensors

MOUNTING DIMENSIONS (for reference only)


CSNA111, CSNB121, CSNB131

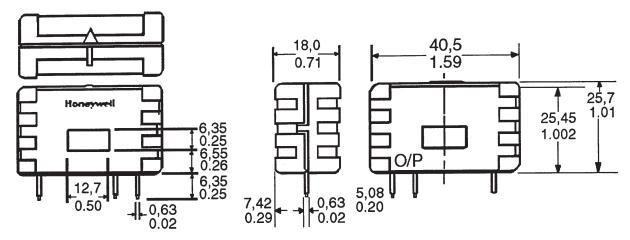

CSNE151/CSNE381

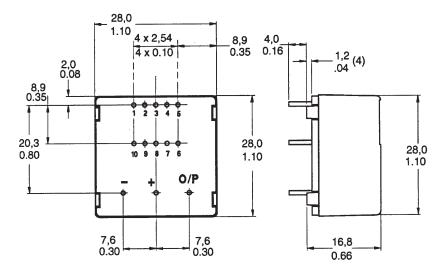

CSNH151

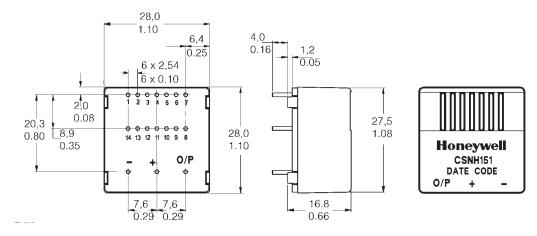

Currer

Closed Loop Current Sensors

CSNJ, CSNK SERIES ORDER GUIDE

Solid State Sensors


	Current	Supply	Coil Cha	racteristics	Meas.	
Catalog Listings	Range Amps	Voltage VDC ± 5%	Turns	Resistance	Currents Nom.	Meas. Resist (@ I _{nom})
CSNJ481	±600	±12 to 18	2000	25Ω @ 70°C	150 mA for 300 A	0 to 70Ω
CSNJ481-001*	±600	±12 to 18	2000	25Ω @ 70°C	150 mA for 300 A	0 to 70 Ω
CSNJ481-002	±600	±12 to 18	2000	25Ω @ 70°C	150 mA for 300 A	0 to 70Ω
CSNJ481-003*	±600	±12 to 18	2000	25Ω @ 70°C	150 mA for 300 A	0 to 70 Ω
CSNK591	±1200	±15 to 24	5000	50Ω @ 70°C	100 mA for 500 A	0 to 130Ω
CSNK591-001*	±1200	±15 to 24	5000	50Ω @ 70°C	100 mA for 500 A	0 to 130Ω
CSNK591-002	±1200	±15 to 24	5000	50Ω @ 70°C	100 mA for 500 A	0 to 130Ω
CSNK591-003*	±1200	±15 to 24	5000	50Ω @ 70°C	100 mA for 500 A	0 to 130Ω

^{*}Fitted with busbar

SPECIFICATIONS

Catalog Listings	CSNJ481 CSNJ481-001	CSNJ481-002 CSNJ481-003	CSNK591 CSNK591-001	CSNK591-002 CSNK591-003		
Offset Current @ 25°C, mA max.	±0.30	±0.30	±0.20	±0.20		
Temperature Drift, 0 to 70°C, mA	±0.30 typ. ±0.50 max.	±0.30 typ. ±0.50 max.	±0.20 typ. ±0.30 max.	±0.20 typ. ±0.30 max.		
Linearity	±0.1%	±0.1%	±0.1%	±0.1%		
Supply Voltage	±12 to ±18V	±12 to ±18V	±15 to ±24V	±15 to ±24V		
Galvanic Isolation @ 50 Hz/1 min.	7.5 kV rms	7.5 kV rms	6 kV rms	6 kV rms		
Accuracy	±0.5% of I _N (nominal 0	±0.5% of I _N (nominal Current) at 25°C				
Response Time	<1 μs					
Bandwidth	DC to 150 kHz					
Operating Temperature	-40 to 85°C (-40 to 185°F)			0 to 70°C (32 to 158°F)		
Storage Temperature	-40 to 90°C (-40 to 194°F)			−25 to 85°C (−13 to 85°F)		
Primary Circuit Connection	Thru-hole or busbar	Thru-hole or busbar	Thru-hole or busbar	Thru-hole or busbar		
Secondary Circuit Connection	3 pins	3 pins	3 pins	3 pins		
Current Drain	14 mA (no load currer	14 mA (no load current) + output current 22 mA (24 V) + output current				
"In-Out" Sense Signal	To obtain positive me	asuring current on O/P	erminal, current must flo	w in direction of arrow		
Mounting	Faston, 3 pins	Faston, 3 pins Push-on (spade), 3 terminals				

WIRING DIAGRAM




Solid State Sensors


Closed Loop Current Sensors

MOUNTING DIMENSIONS (for reference only)

CSNJ481

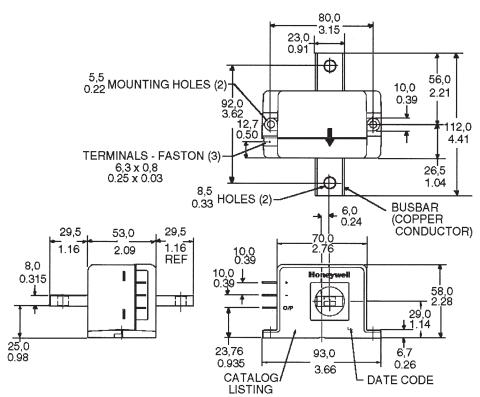

CSNK591

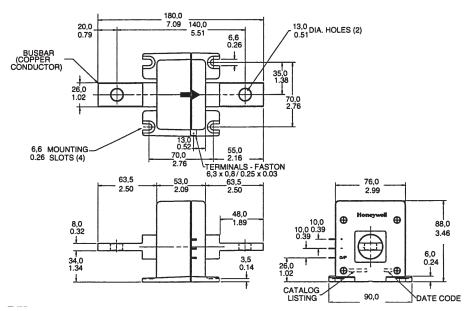

Solid State Sensors

Closed Loop Current Sensors


CSNL, CSNM SERIES ORDER GUIDE

	Peak	Supply	Coil Cha	racteristics	Meas.	
Catalog Listings	Listings Current Range Amps		Turns	Resistance	Currents Nom.	Meas. Resist (@ I _{nom})
CSNL181	±600	±12 to 18	2000	25Ω @ 70°C	150 mA for 300 A	0 to 70 Ω
CSNM191	±1000	±12 to 18	5000	50Ω @ 70°C	100 mA for 500 A	0 to 120 Ω

SPECIFICATIONS

Catalog Listings	CSNL181	CSNM191		
Offset Current @ 25°C, mA max.	±0.30	±0.20		
Temperature Drift, 0 to 70°C, mA	±0.30 typ. ±0.50 max.	±0.20 typ. ±0.30 max.		
Linearity	±0.1%	±0.1%		
Supply Voltage	±12 to ±18V	±12 to ±18V		
Galvanic Isolation @ 50 Hz/1 min.	7.5 kV rms	7.5 kV rms		
Accuracy	±0.5% of I _N (nominal Curre	nal Current) at 25°C		
Response Time	500 ns	<1 μs		
Bandwidth	DC to 150 kHz			
Operating Temperature	-40 to 85°C (-40 to 185°l	F)		
Storage Temperature	-40 to 90°C (-40 to 194°l	F)		
Primary Circuit Connection	Thru-hole	Thru-hole		
Secondary Circuit Connection	3 pins	3 pins		
Current Drain	14 mA (no load current) +	14 mA (no load current) + output current		
"In-Out" Sense Signal	To obtain positive measuri in direction of arrow	To obtain positive measuring current on O/P terminal, current must flow in direction of arrow		
Mounting	Faston, 3 pins			


WIRING DIAGRAM




Closed Loop Current Sensors

MOUNTING DIMENSIONS (for reference only)

CSNL181

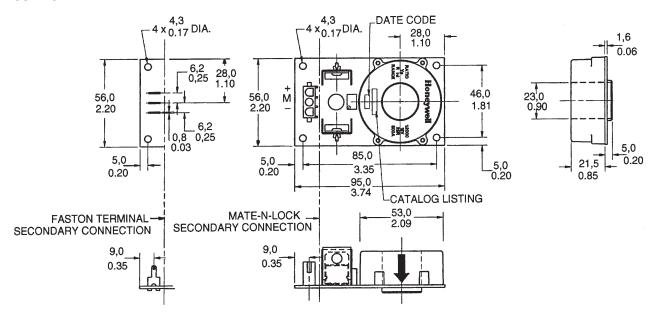

CSNM191

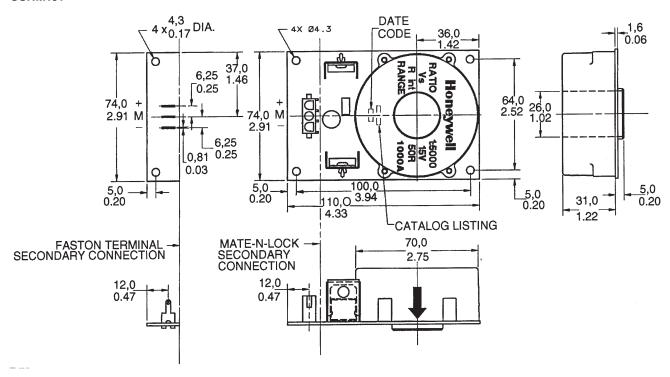

Closed Loop Current Sensors

Solid State Sensors

CSNF, CSNR, CSNP, CSNT SERIES ORDER GUIDE


	Peak	Peak Supply		racteristics	Meas.	
Catalog Listings	Current Range Amps	Voltage VDC ± 5%	Turns	Resistance	Currents Nom.	Meas. Resist (@ I _{nom})
CSNP661	±90	±12 to 15	1000	30Ω @ 70°C	50 mA for 50 A	50 to 100 Ω
CSNT651	±150	±12 to 15	2000	100Ω @ 70°C	25 mA for 50 A	40 to 75 Ω
CSNF161	±150	±12 to 15	1000	30Ω @ 70°C	100 mA for 100 A	10 to 40Ω
CSNF151	±180	±12 to 15	2000	100Ω @ 70°C	50 mA for 100 A	10 to 75Ω
CSNR161	±200	±12 to 15	1000	30Ω @ 70°C	125 mA for 125 A	30 to 40Ω
CSNR151	±200	±12 to 15	2000	100Ω @ 70°C	62.5 mA for 125 A	10 to 40Ω

NOTE: Busbar options available.

SPECIFICATIONS


Catalog Listings	CSNP661	CSNT651	CSNF161	CSNF151	CSNR161	CSNR151		
Offset Current @ 25°C, mA max.	±0.20	±0.10	±0.20	±0.10	±0.20	±0.10		
Temperature Drift, 0 to 70°C, mA	±0.30 typ. ±0.50 max.	±0.15 typ. ±0.25 max.	±0.30 typ. ±0.50 max.	±0.15 typ. ±0.25 max.	±0.30 typ. ±0.60 max.	±0.15 typ. ±0.30 max.		
Linearity	±0.1%	±0.1%	±0.1%	±0.1%	±0.1%	±0.1%		
Supply Voltage	±12 to 15V	±12 to 15V	±12 to 15V	±12 to 15V	±12 to 15V	±12 to 15V		
Galvanic Isolation @ 50 Hz/1 min.	3 kV rms	3 kV rms	3 kV rms	3 kV rms	3 kV rms	3 kV rms		
Accuracy	±0.5% of I _N (n	±0.5% of I _N (nominal Current) at 25°C						
Response Time	<500 ns	<500 ns						
Bandwidth	DC to 150 kHz	<u>.</u>						
Operating Temperature	−40 to 85°C (−40 to 185°F)	-40 to 85°C (-	−40 to 185°F)				
Storage Temperature	−40 to 90°C (−40 to 194°F)	-40 to 90°C (-	–40 to 194°F)				
Primary Circuit Connection	Thru-hole							
Secondary Circuit Connection	3 pins							
Current Drain	,	10 mA (no load current) + output current 14 mA (no load current) + output current						
"In-Out" Sense Signal	To obtain pos	itive measuring	current on O/P t	erminal, current	must flow in dir	ection of arrow		
Mounting	3 pins	3 pins						
Pin Style	А	А	В	В	В	В		


WIRING DIAGRAM




Solid State SensorsClosed Loop Current Sensors

MOUNTING DIMENSIONS (for reference only)

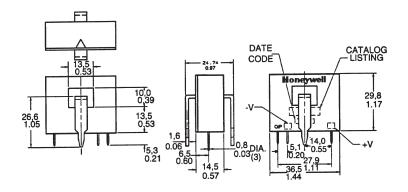

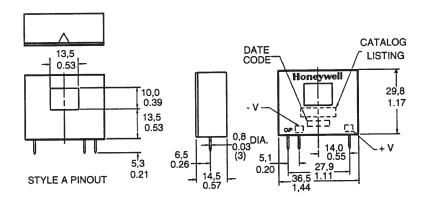

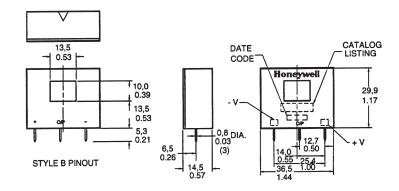

68